

DALTON & HEYNE

SALES ENGINEERS

SAN ANTONIO & HOUSTON, TEXAS

San Antonio, Texas,
August 16, 1927.

SAN ANTONIO OFFICE
1009 TRAVIS BUILDING
PHONE CROCKETT 6586

HOUSTON OFFICE
1001 ELECTRIC BUILDING
PHONE GOLFAX 1810

Mr. M. J. Sullivan,
Second Natl. Bank Bldg.,
Houston, Texas.

RE: Negro Hospital.

Dear Mr. Sullivan,

The writer, together with Mr. Heyne, made a trip to the above Hospital to learn what was causing the trouble with the sterilizing equipment.

For your information, please be advised that Mr. Rogerson has not completed the connecting of the Crane tilt return trap, since the vent from the trap instead of being left plugged, should be run through a 1/4" pipe into the chimney. There should be a valve in this line, in order that it could be cracked sufficient to leave a very small opening. At the present time the trap is entirely air bound.

Mr. Rogerson has never made any return connections to any of the sterilizing equipment on the second floor and the specifications called for each machine to be properly trapped. Also the specifications call for a drip trap at the base of the main line to relieve line of water.

If the above changes are made, there will be no reason why this system will not function properly, and the writer does not see how Mr. Rogerson could leave the job in the shape that he has. We suggest that you compel him to vent the return trap and install a Fisher 1/2" bucket type high pressure drip trap at the base of the main riser and one at each fixture, and every trap should be properly by-passed.

If you would endeavor to get an exact cut of the equipment which has been furnished the Institution, we will then make a diagram showing steam and return connections to the machines. The cuts of the equipment which they have are not identically similar to the machines which were bought. Therefore, we would hesitate to state just where the steam and return connections should be made, since as you know, almost every sterilizing machine has connections at different locations.

Mr. M. J. Sullivan.

August 16, 1937.


RE: Negro Hospital.

Page #2.

We also believe that Mr. Rogerson should be compelled to install a lever handle ground key stop cock in the ^{cool}ground water line to the boiler, since the fireman states that the present valve is continually leaking, and upon investigation we found that this was nothing but a common globe valve.

Regretting that you were out of town Monday and that I was unable to make our report to you in person, and looking forward to seeing you on my next trip, I am,

Yours very truly,

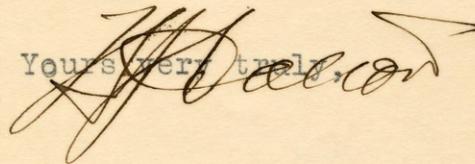

HJD/ES.